

7000 SERIES HEAVY DUTY SURFACE DOOR STOPS AND **HOLDERS - INSTRUCTIONS**


Screw Chart						
HARDWAWRE	QTY	Screw type				
Jamb	4	#14 x 1-1/2" FPHWS				
	4	1/4-20 x 5/8" FPHMS				
Door	2	5/16"-18 x1-1/2" FPHMS				
	2	5/16"-18 x 1-9/16" THRU BOLT				
Arm	3	5/16"-18 x 5/16" HBHFS				
	1	5/32" HEX KEY				

Pre Installation Notes:

- 1. Hollow metal frames must be properly reinforced with 3/16" [5] thick plates that are at least 12" [305] long. 2. Hollow metal doors must be properly reinforced with 3/16" [5] thick plates that are at least 2-1/2" [64] wide.
- 3. Hold open(7017) and Friction(7015) are not permitted for use on fire doors.
- 4. Stop only(7016) is subject to job specification for fire door use.

2. INSTALL OVERHEAD DOOR HOLDER/STOP (ODHS) (Right Hand Shown)

the "A" and "C" body mounting hole locations. Install the main body

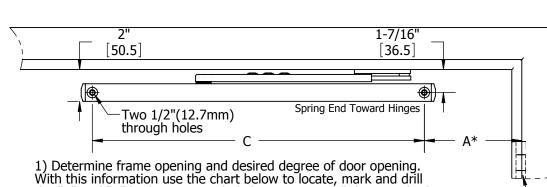

Door


¬Frame reinforcement


Hinge €

Reinforcements

with spring end toward hinge edge. Note: All dimensions are taken from the hinge center line.

		85-95 degree of opening		96-110 degree of opening		
ODHS Size	Door Width	А	В	А	В	С
7000 SZ1 -	24"-30"	1-3/8" [34.9]	7" [177 0]	1-3/8" [34.9]	7" [177.8]	20-3/4" [527]
	31"-40"	6" [152.4]	7" [177.8]	5" [127]		
7000 SZ2	41"-45"	11-1/2" [292.1]	11" [279.4]	10" [254]	10" [254]	25-13/16" [655.6]
	46"-55"	16" [406.4]		14-1/2" [368.3]		

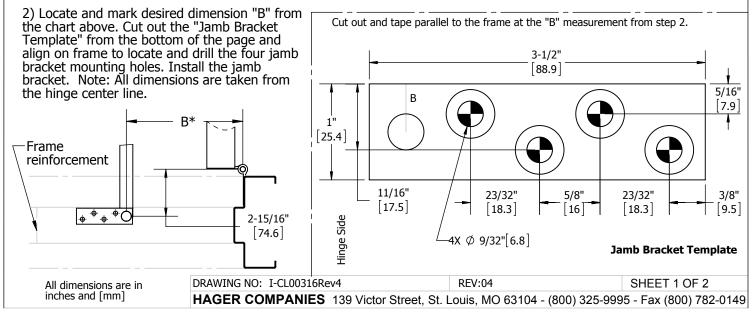

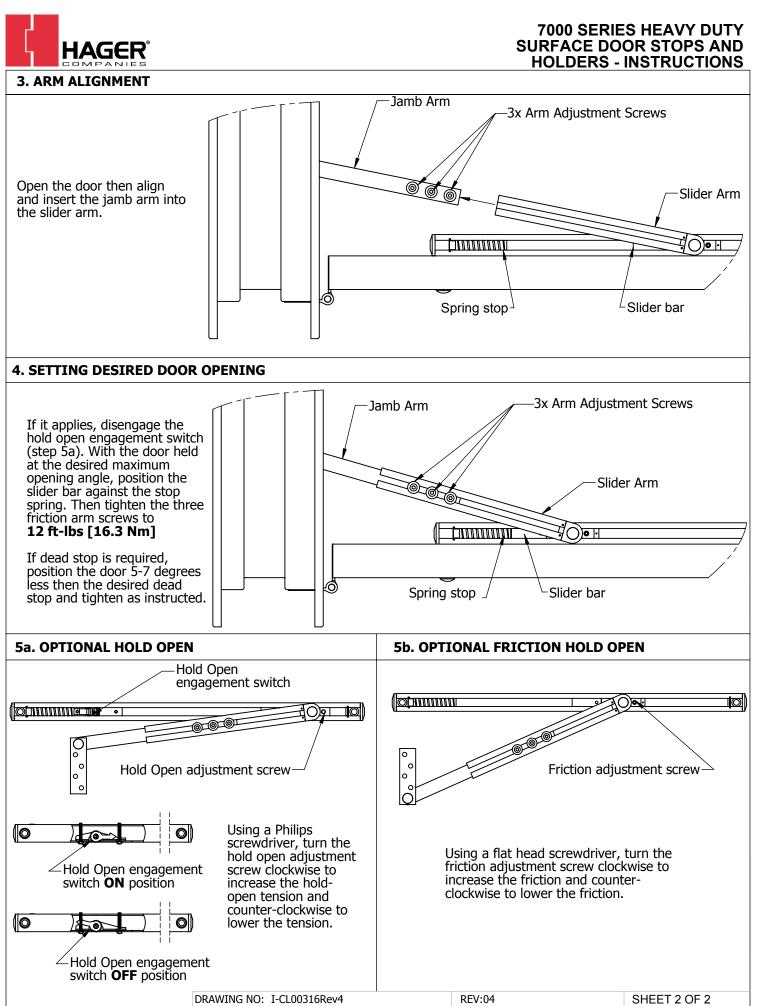

HAGER COMPANIES 139 Victor Street, St. Louis, MO 63104 - (800) 325-9995 - Fax (800) 782-0149